

THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816

www.THEHOME | NSPECTOR.com



RADON REPORT



7 Mountain Wood - Sandy, UT

The purpose of the radon screening is to provide a professional opinion of a structure's radon levels as of the date of screening; limited to the test conditions identified in this report.

LIMITATIONS OF LIABILITY: Our radon testing firm cannot be assured that the necessary conditions were maintained throughout the screening period. There can be uncertainty with any radon measurement due to statistical variations and other factors such as changes in the weather and operation of the dwelling. While we and our agents make every effort to maintain the highest possible quality control and include checks and verification steps in our procedures, we make NO WARRANTY OF ANY KIND, EXPRESSED OR IMPLIED, for the consequences of erroneous test results. Neither the radon testing firm nor our employees or agents shall be liable under any claim, charge or demand, whether in contract, tort, or otherwise, for any and all loss, cost charge, claim, demand, fee, expense or damage of any kind arising out of, connected with, resulting from, or sustained as a result of any radon test.

THIS REPORT IS PROTECTED BY COPYRIGHT!
REPRODUCTION, IMITATION, OR DUPLICATION OF THE REPORT
WILL BE SUBJECT TO PENALTIES PROVIDED BY FEDERAL
COPYRIGHT LAWS.



CLIENT & INSPECTION INFORMATION

CLIENT'S NAME: Vivek & Cara Reddy

DATE OF INSPECTION: 05/26/2023
START TIME: 9:00 AM
INSPECTION #: 52623A

INSPECTOR: Michael D. Leavitt - Master Inspector

CLIENT'S AGENT: Sarah Burns - Berkshire Hathaway Home Services

Copyright: Michael Leavitt, 2023 RADON REPORT INSPECTION #52623A PAGE #1 of 6
This Confidential Report Prepared for the Exclusive Use of Vivek & Cara Reddy. * DO NOT DUPLICATE WITHOUT PERMISSION



THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816





GENERAL INFORMATION

SCREENING START INFORMATION

START DATE: 5/26/2023.
START TIME: 10:15.
AMBIENT TEMPERATURE: 64 degrees.
INSIDE TEMPERATURE: 69 degrees.
WEATHER: Sunny.
HOUSE OCCUPIED? Yes.

SCREENING STOP INFORMATION

STOP DATE: 5/29/2023.
STOP TIME: 9:05 AM.
AMBIENT TEMPERATURE: 61 degrees.
INSIDE TEMPERATURE: 69 degrees.
WEATHER: Sunny.

BUILDING CHARACTERISTICS:

ESTIMATED AGE OF HOUSE: 1978.

BUILDING TYPE: Single Family Dwelling.

STORIES:

FOUNDATION STYLE: Basement. BASEMENT: Finished.

BASEMENT WALLS: Poured concrete.
HOUSE TIGHTNESS: Very tight.

ATTIC FANS: There is no attic fan installed to depressurize the attic cavity.

JENN-AIRE There is no Jenn-Aire style range in the kitchen.

WELL WATER: No. The home does not use well water.

HEATING SYSTEM: Forced air gas system.

COOLING SYSTEM: Central air conditioning system.

FAN OPERATION: The circulation fan was operated in the "Automatic" mode during the

screening.

Copyright: Michael Leavitt, 2023 RADON REPORT INSPECTION #52623A PAGE #2 of 6
This Confidential Report Prepared for the Exclusive Use of Vivek & Cara Reddy. * DO NOT DUPLICATE WITHOUT PERMISSION



THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816

www.THEHOME | NSPECTOR.com



CRM TEST & PROTOCOLS

CONTINUOUS MONITOR TESTING:

CONTINUOUS MONITOR: Sun Nuclear Continuous Radon Monitor Model 1028.

DATE OF LAST CALIBRATION: March 2023.

EXPLANATION OF CRM DATA: The measurement was performed using a Continuous Radon Monitor (CRM), and was performed in conformance with test protocols established by the US Environmental Protection Agency in the document entitled "Protocols for Radon and Radon Decay Product Measurements in Homes."

TABULAR DATA: This portion of the data provides numerical listing of the Radon gas measurements that were made throughout the measurement period.

AVERAGE: This portion of the data gives the average Radon gas concentration measured during the entire measurement period. This average is computed in two ways. The "Overall Average" is the average of all of the values listed in the Tabular Data. The "EPA Average" is the average of all of the values listed in the Tabular Data, except those values recorded in the first four hours of the measurement period. The "EPA Average" is computed in a manner consistent with the protocols cited in the "Protocols for Radon and Radon Decay Product Measurements in Homes."

OTHER INFORMATION: In the printout, the letter "P" or "M" may appear next to a given value. The "P" indicates that, during this measurement interval, the power was disconnected to the CRM. The "M" indicates that, during this measurement interval, the CRM was disturbed or moved.

RESULTS: The action level established by the US EPA and Surgeon General is 4 pCi/l. Results under the action level of 4 pCi/l are still considered a risk. Final test results averaging over 4 pCi/l are considered a risk that should be mitigated. Excessive radon levels is an indoor air quality issue related to cancer that can be improved with the addition of a radon mitigation system.

RESULTS IN pCi/I:

OVERALL AVERAGE pCi/I: 4.5 pCi/I. EPA AVERAGE pCi/I: 4.6 pCi/I.

HOURLY READINGS: Date: 05/26/2023

Time Counts Flags pCi/l 11:15 2.6

12:15 1.8 13:15 4.4

14:15 1.8 15:15 5.1 16:15 1.8

17:15 4.0 18:15 3.7

19:15 0.7 20:15 1.5 21:15 0.7

22:15 2.2 23:15 1.8

Date: 05/27/2023 Time Counts Flags

pCi/l

00:15 2.9 01:15 4.0

02:15 3.7 03:15 1.1

04:15 6.9 05:15 3.3

Copyright: Michael Leavitt, 2023 RADON REPORT INSPECTION #52623A PAGE #3 of 6
This Confidential Report Prepared for the Exclusive Use of Vivek & Cara Reddy. * DO NOT DUPLICATE WITHOUT PERMISSION



THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816

www.THEHOME NSPECTOR.com



```
06:15
        4.8
07:15
        6.6
08:15
        9.1
09:15
        5.8
10:15
        9.1
11:15
        6.9
12:15
        6.2
13:15
        5.5
14:15
        4.0
15:15
        4.8
16:15
        6.9
17:15
        4.8
18:15
        2.6
19:15
        1.8
20:15
        4.4
21:15
        1.8
22:15
        1.1
23:15
        2.9
Date:
        05/28/2023
Time
        Counts Flags
        pCi/l
00:15
        3.3
01:15
        2.9
02:15
        3.7
03:15
        4.8
04:15
        3.3
05:15
        3.3
06:15
        6.6
07:15
        7.7
08:15
        5.5
09:15
        4.8
10:15
        4.4
11:15
        5.8
12:15
        4.8
13:15
        3.7
14:15
        4.8
15:15
        5.5
16:15
        3.3
17:15
        4.0
18:15
        4.0
19:15
        5.5
20:15
        4.0
21:15
        5.8
22:15
        2.9
23:15
        3.3
        05/29/2023
Date:
        Counts Flags
Time
        pCi/l
00:15
        5.8
01:15
        4.4
02:15
        5.5
03:15
        6.9
04:15
        9.5
05:15
        9.1
06:15
        6.2
07:15
        8.4
08:15
        6.9
```




THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816

www.THEHOME NSPECTOR.com



GRAPH:

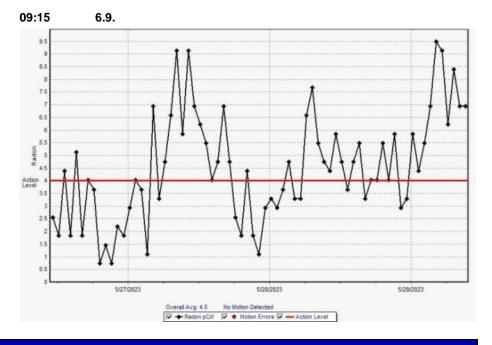

PROTOCOLS OBSERVED:

CLOSED HOUSE: Yes.
CLOSED WINDOWS: Yes.
CLOSED DOORS: Yes.

PLACEMENT: The Radon screening device was placed away from drafts & heat and 4" of

perimeter clearance..

HEIGHT: The screening device was placed at least 20" off of the floor on a tripod, 1 foot

from exterior walls and 3 feet from exterior openings.

WINDS: Sustained winds of over 30 MPH did not occur during the screening.

RAINFALL: Total rainfall during this screening did not exceed 1/2".

CERTIFICATION SEALS: Certification seals were not used in the screening.

ACTIVE MONITORING: Active monitoring was not used on the doors.

MITIGATION SYSTEM: There is no active Radon mitigation system installed in the home.

SCREENING DEVICE LOCATION: The unit was placed on the west wall of the

basement SW bedroom.



Copyright: Michael Leavitt, 2023 RADON REPORT INSPECTION #52623A PAGE #5 of 6
This Confidential Report Prepared for the Exclusive Use of Vivek & Cara Reddy. * DO NOT DUPLICATE WITHOUT PERMISSION



THE MOST QUALIFIED INSPECTOR IN UTAH!

591 W. 760 North * Orem, Utah 84057 * 801-636-6816





SUMMARY

USEPA RECOMMENDATIONS:

RECOMMENDATIONS:

OVER 4 pCi/l - The USEPA states that for "EPA AVERAGE" test results 4pCi/l and higher, remedial actions should be performed to lower the home's Radon level. It is recommended that you contact a Radon Mitigation specialist for more details.

EPA LISTED MITIGATORS:

UTAH RADON MITIGATORS:

There are very few radon mitigation firms in the state of Utah. Below are three that I located on a national listing for approved radon mitigation providers. I encourage you to call each and inquire about their experience and installation fees. It is also important to have them demonstrate to you that the system being installed will meet or exceed the EPA standards. My opinion is that it does no good to cut corners, save a buck, and then end up with a system that will be red flagged later as not meeting the EPA standards. If these providers do anything in an unprofessional manner, then please notify me and I will remove them from my list. By the same token, if they do a great job then please let share that feedback as well.

Radon Away Inc. * Salt Lake City * (801)205-7788 *

www.RadonUtah.com

Radon Be Gone Inc. * Clearfield * (801)510-8705 *

www.RadonBeGone.com

Greene Concrete Cutting, Inc. * Woods Cross * (801) 292-6699 *

www.greeneconcretecutting.com.

REPORT PREPARED BY

upal D. Leavetto

TESTING PROFESSIONAL:

PREPARATION DATE: 05/29/202

Copyright: Michael Leavitt, 2023 RADON REPORT INSPECTION #52623A PAGE #6 of 6
This Confidential Report Prepared for the Exclusive Use of Vivek & Cara Reddy. * DO NOT DUPLICATE WITHOUT PERMISSION